

# SGX-4H2S-100 Datasheet

## Industrial Hydrogen Sulphide (H<sub>2</sub>S) Sensor

### PERFORMANCE

Output signal	1200 ± 250 nA / ppm
Typical Baseline Range (pure air)	±2ppm H <sub>2</sub> S equivalent
T90 Response Time	< 30 seconds
Measurement Range	0 - 100 ppm
Maximum Overload	500 ppm
Linearity	Linear
Repeatability	< ±2% H <sub>2</sub> S equivalent
Recommended Load Resistor	10 ohms
Resolution (Electronics dependent)	<0.1 ppm typical

### OPERATING CONDITIONS


Temperature Range	-30°C to +50°C
Pressure Range	800 to 1200 mbar
Operating Humidity Range	15% to 90% RH

### LIFETIME

Long Term Output Drift	< 20% per annum
Recommended Storage Temp	0°C to 20°C
Expected Operating Life	> 24 months in air

### OUTLINE

All dimensions are in mm  
 All tolerances are ±0.15mm

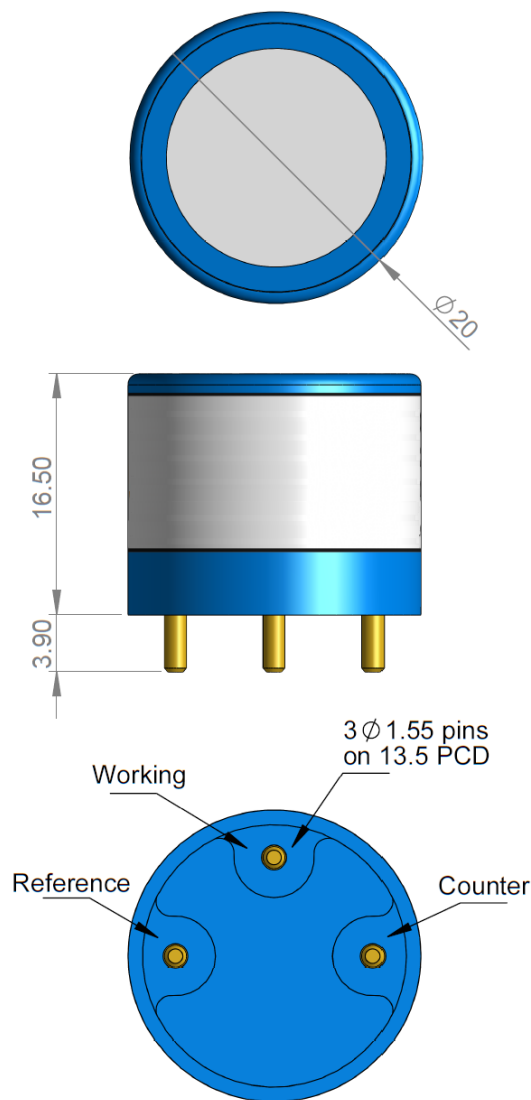

### INTRINSIC SAFETY DATA


Max at 2000ppm	0.3 mA
Max o/c Voltage	1.3 V
Max s/c Current	<1.0 A

## CROSS – SENSITIVITY DATA

GAS	CONCENTRATION	SGX-4H2S-100
Carbon Monoxide	100ppm	< 2ppm
Sulphur Dioxide	5ppm	<0.5ppm
Nitrogen Dioxide	5ppm	-1ppm
Nitric Oxide	35ppm	<0.5ppm
Ammonia	50ppm	0ppm
Chlorine	15ppm	0ppm
Ethylene	100ppm	0ppm

\* See Important Notes

## Output vs Temp

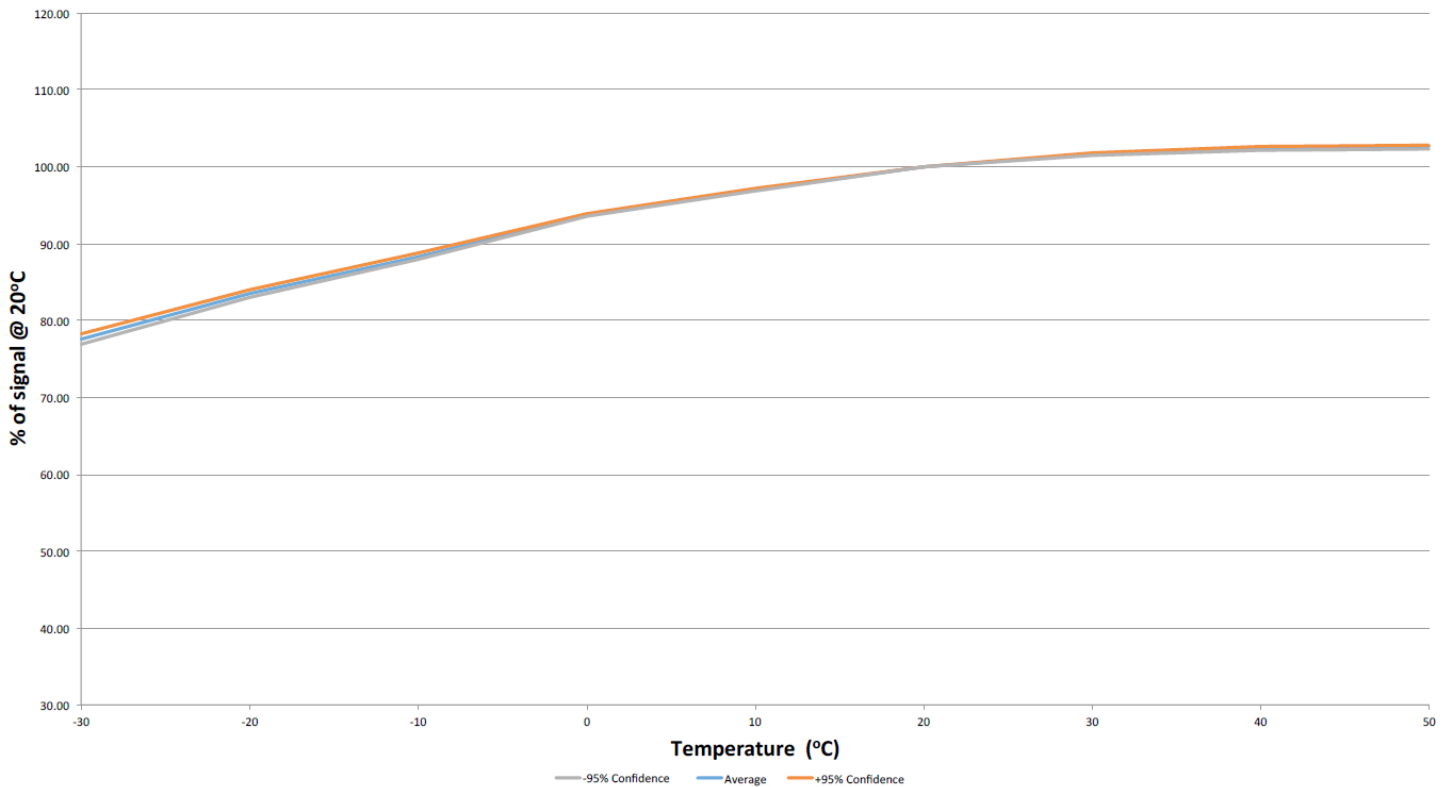

## IMPORTANT NOTES

- 1) Do not glue or solder to the connector pins as this may damage the sensor and thereby invalidate the warranty, please use PSB sockets.
- 2) Details on recommended connector pins can be found in the Frequently Asked Questions within the Gas Sensor section of the SGX website.
- 3) All performance specifications are based upon the following environmental conditions: 20°C, 50% relative humidity, 101kPa.
- 4) Cross Sensitivity Data is for information only. Calibration is recommended with target gas as the accuracy of calibration and measurement cannot be ensured.
- 5) The cross sensitivities are including but not limited to the gases stated in the table. It may respond to other gases.
- 6) The cross sensitivities may fluctuate between  $\pm 30\%$  and may differ from batch to batch or across sensor's life time.
- 7) The device is designed to be RoHS compliant.
- 8) Poisoning - sensors are designed to operate in a wide range of harsh environments and conditions. However, it is important that exposure to high concentrations of solvent vapours is avoided, both during storage, fitting into instrument and operation.
- 9) When using sensors on printed circuit boards (PCB's), degreasing agents should be used prior to the sensor being fitted.

### Warning:

By the nature of the technology used, any electrochemical gas sensor offered by SGX Europe Sp. z o.o. can potentially fail to meet specification without warning. SGX Europe Sp. z o.o. makes every effort to ensure the reliability of our products of this type, where life safety is a performance requirement of the product, we recommend that all sensors and instruments using these sensors are checked for response to gas before use. SGX Europe Sp. z o.o reserves the right to make product changes without notice. No liability is accepted for any consequential losses, injury or damage resulting from the use of this document or from any omissions or errors herein. The data is given for guidance only. It does not constitute a specification or an offer for sale. The products are always subject to a program of improvement and testing which may result in some changes in the characteristics quoted. As the products may be used by the client in circumstances beyond the knowledge and control of SGX Europe Sp. z o.o, we cannot give any warranty as to the relevance of these particulars to an application. It is the clients' responsibility to carry out the necessary tests to determine the usefulness of the products and to ensure their safety of operation in a particular application. Performance characteristics on this data sheet outline the performance of newly supplied sensors. Output signal can drift below the lower limit over.